

30

Date: Wednesday, 6/27/2007 1:08:03 PM  
User: Kim Johnston

# Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B  
Job Number : 33211  
Estimate Number : 10163  
P.O. Number : N/A Part Number : D206642241  
This Issue : 6/27/2007 S.O. No. : N/A Drawing Number : D2650 REV E  
Prsht Rev. : NC Project Number : N/A  
First Issue : N/A Type : LANDING GEAR Drawing Revision : E  
Previous Run : 33080A Material : N/A  
Due Date : 7/22/2007 Qty: 1 Um: Each  
Written By :  
Checked & Approved By : JS 07-06-28  
Comment : Est Rev.M 04.12.02 Revised procedural steps KJ/JLM

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



JS 07-06-28

Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-241

CHG003

JS 07-06-28

2.0 D2620 Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2620 Bent Tube 3" OD

B33829 DP 7-8-15

3.0 D32861 Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-1 Doubler

B32514 DP 7-8-21

4.0 D2647 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2647

Fwd Cap

B27328 BE 07-8-21

5.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

DP 7-8-15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 6/27/2007 1:08:03 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 33211

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

DP 7-8-15

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

A/R

Aluminum Rod

M 104221 BE 07-08-21

4-Grind weld flush to cap on top surface only.

BE 07-08-21

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

8-Drill pilot holes using Dt 8167.

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

10-Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

13-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder

14-Remove indexing edge using DT8741 as per Dwg D2650

Pm 07-08-21

15-C'sink GHW rivet holes as per Dwg D2650

Pm 07-08-21

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

EN 07/08/08

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 6/27/2007 1:08:03 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 33211

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125" as per Dwg D2650

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

3-Deburr tube and blow out chips from inside the tube

*for 07-08-22*

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

*for 07-08-22*

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*BE 07-08-22*

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

*for 07-08-22*

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

*BE 07-08-22*

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total : 52.0000 Each(s)

Pick:

Qty Part Number Description Batch

52 CR3212-4-04 Rivet *m104793*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 6/27/2007 1:08:03 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 33211

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

D26543

206 I-Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2654-3

Web

*B-33418 AUM 07/08/07*

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

*AUM 07-08-22*

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: *07/08/07*

Time: *1:30*

Finish Date: *07/08/08*

Time: *11:00*

Pick:

Qty Part Number

Description Batch

A/R Sikaflex-291

Sikaflex expire date:

*07104949 07/10/01*

*AUM 07/08/07*

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*Er 07/08/28 (X)*

16.0

D2649

Crossbolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description Batch

18 D2649

Crossbolt spacer

*33214 BE 07-08-28*

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 D3286-3

Spacer

*32781 BE 07-07-04*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Wednesday, 6/27/2007 1:08:03 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 33211

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod

M104221

BE 07-08-28

2-Grind welds flush as per Dwg D2650.

R 07-08-28

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/RSS Rod

NONE

BE 07-09-04

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr

R 07-09-04

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets

M103525

(2)

R 7-9-4

20.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 M7885/3-4-3 Rivets

M102515

(2)

R 7-9-4

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2680-041

Nut Plate

B30446

(1)

R 7-9-5

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 6/27/2007 1:08:03 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 33211

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

R 7-9-4

23.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

07/09/11

24.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

En 07/02/11

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

ml 07 09 12

①

26.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

07-09-13

①

27.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

07/09/14 ①

28.0

D26483

Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:

Qty Part Number

Description Batch

4 D2648-3

Wearpad

~~D2648-3~~ D32465

FL

29.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-13

Wearshoe

D31889

FL 07/09/14 ①

# Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 6/27/2007 1:08:03 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 33211

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-21

Wearshoe

129/18

FL

31.0

D265633

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-33

Wearshoe

132281

FL

32.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3429-1

Wearpad

132510

FL

33.0

ALS41032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 ALS4-1032-130 Inserts

or (see QSI 017)

102475

FL

34.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 AN960JD10L

Washer

104885

FL 07/09/14 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 6/27/2007 1:08:03 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 33211

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

MS27039108

Screw



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 MS27039-1-08

Screw

m/05433

FL

36.0

D26511

Plug



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

18 D2651-1

Plugs

632576

FL

37.0

D26513

O-Ring



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

18 D2651-3

O-Rings

1534186

FL

38.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 MS27039-4-06

Screw

m/15194

FL

39.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 AN960JD416

Washer

m/103338

FL

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

m/104989

FL 07/09/14 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Wednesday, 6/27/2007 1:08:03 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 33211

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

Sikaflex expire date: 08-01

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650 (D2650-3 detail). Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

FL 07/09/14 (1)

41.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
1 D2646 Aft Cap B31335

FL

42.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch  
2 MS27039-1-08 Screw M105433

FL

43.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch  
2 AN960JD10L Washer M104885

FL

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M104989

Sikaflex expire date: 08-01

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4

Batch: M105386 M1070916

(1)

> FL 07/09/14 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes (No) DQA: ED Date: 02/11/17  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 6/27/2007 1:08:03 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 33211

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

45.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

ED 07/02/17

46.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

ED 07/02/17

47.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206664241 IF APPLICABLE

Location: \_\_\_\_\_

PPP Rev: \_\_\_\_\_

F

07/19/17 (1)

48.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

ED 07/19/17

Job Completion



W 07/09/17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**DART**

DESIGN <i>UP</i>	DRAWN BY <i>P</i>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>H</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	

RELEASED  
16 04 17 *H*


Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

**NOTES**


- WELD PER DART QSI 004
- DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 60 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN TO THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- FINISH:  
-CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3  
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

**Copyright © 1997 by DART AEROSPACE USA, INC.**






THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.  THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	DESIGN <i>CP</i>	DRAWN BY <i>CP</i>	 <b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	REV. E	
	CHECKED <i>PH</i>	APPROVED <i>H</i>		DRAWING NO. <b>D2650</b>	SHEET 2 OF 5
	DATE <b>06.03.30</b>	TITLE <b>SKIDTUBE</b>		SCALE 1:10	



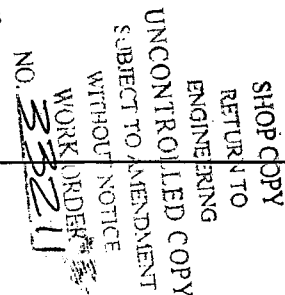




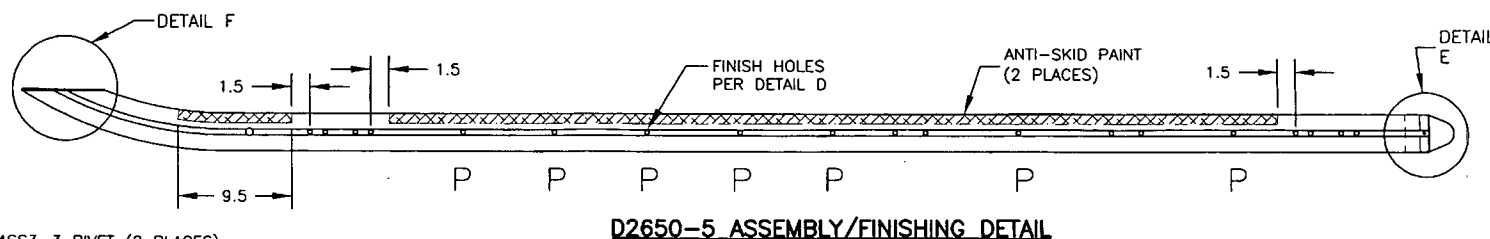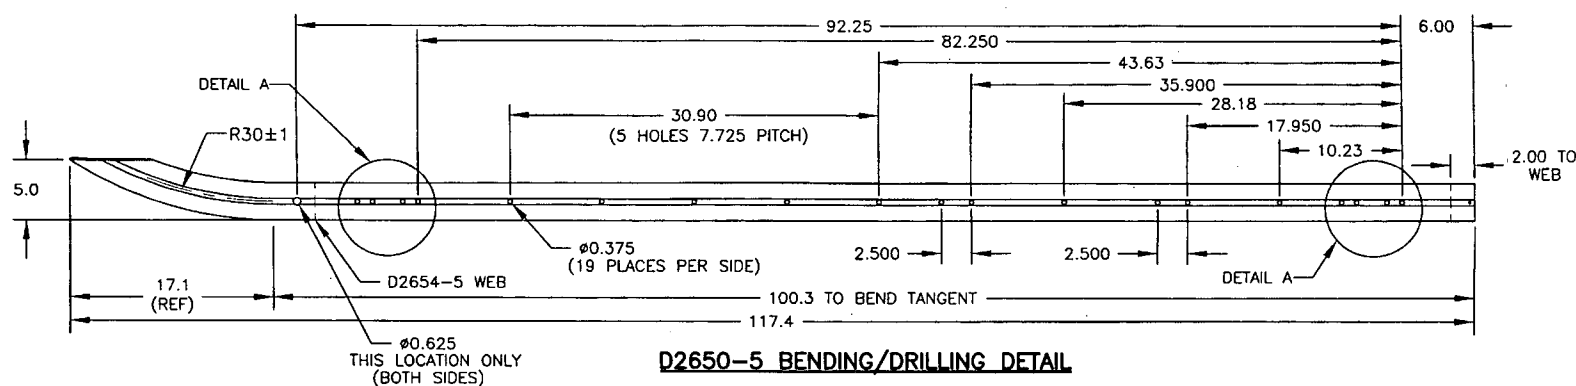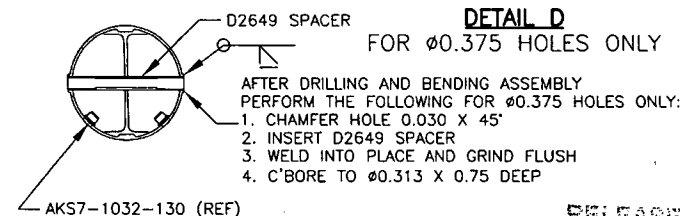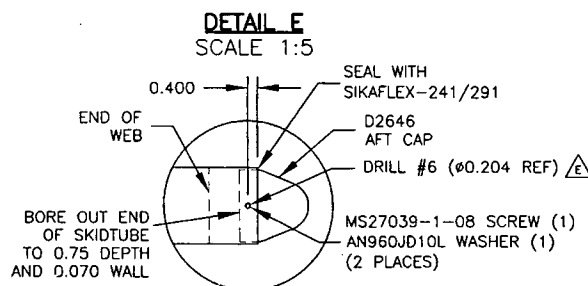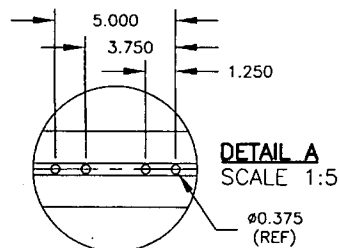

#### DETAIL F (NOT TO SCALE)

- CUT TUBE LEVEL
- REMOVE RIDGE ON FWD SIDE
- LOCATE D2647 (TRIM AS NECESSARY)
- WELD D2647 IN PLACE PER DART QSI 004
- GRIND FLUSH
- RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH









REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

UNCONTROLLED COPY  
ENGINEERING  
RETURN TO  
SHOP COPY  
NO. 53211  
WORK ORDER  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	PH	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED	PH	APPROVED	PH	DRAWING NO. D2650
DATE	06.03.30	TITLE	SKIDTUBE	REV. E SHEET 4 OF 5 SCALE 1:10

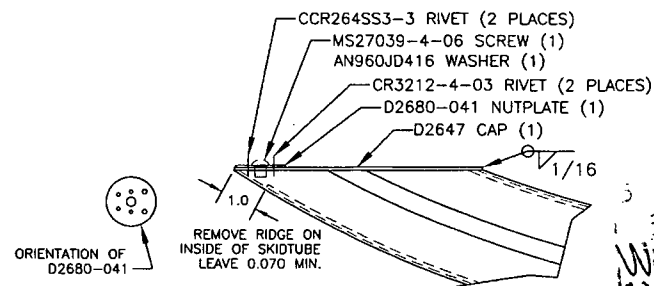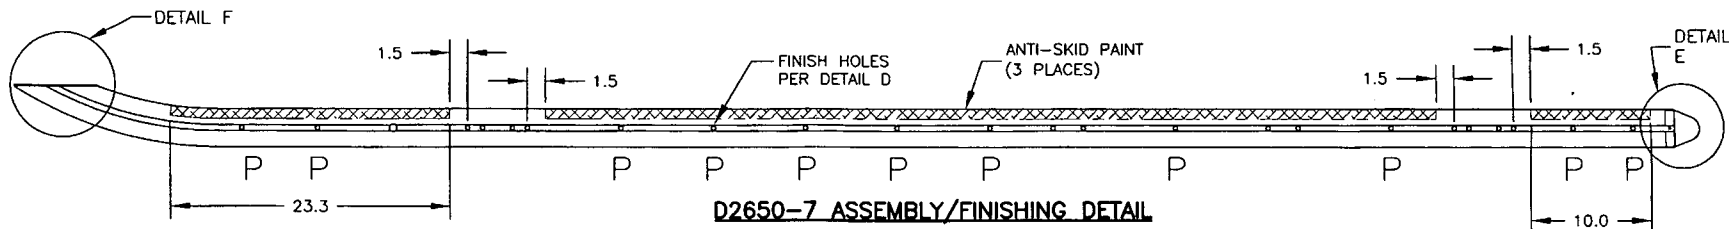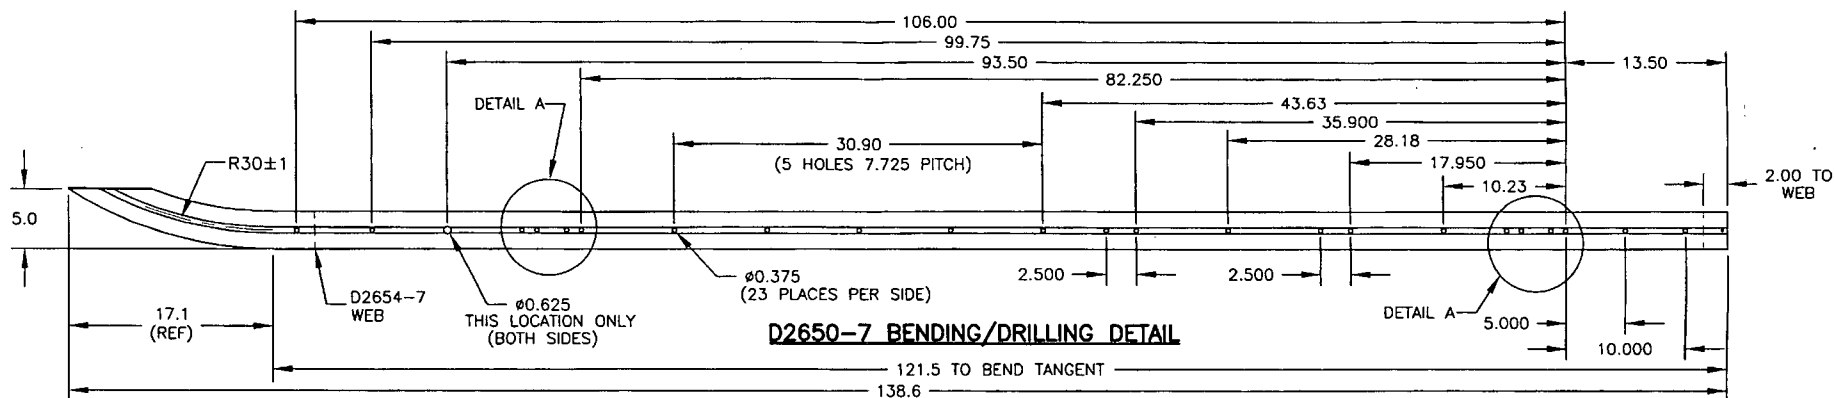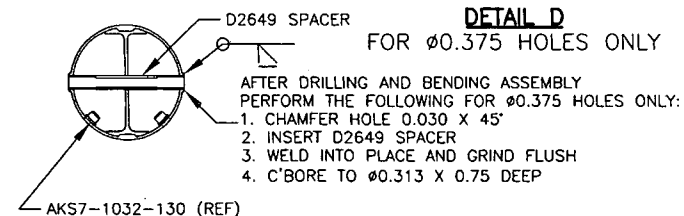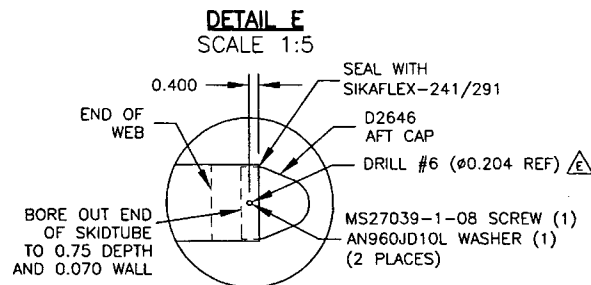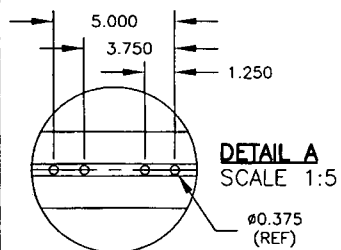

- DETAIL F (NOT TO SCALE)**
1. CUT TUBE LEVEL
  2. REMOVE RIDGE ON FWD SIDE
  3. LOCATE D2647 (TRIM AS NECESSARY)
  4. WELD D2647 IN PLACE PER DART QSI 004
  5. GRIND FLUSH
  6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

WORK ORDER  
38211  
HOP COPY  
RETURN TO  
ENGINEERING  
FOR ROLLED COPY  
TO AMENDMENT  
WITHOUT NOTICE

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	CF	DRAWN BY	CF	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED	PH	APPROVED	CH	DRAWING NO. D2650
DATE	06.03.30	TITLE	SKIDTUBE	REV. E SHEET 5 OF 5 SCALE 1:10

RELEASED  
06.04.07

NO. 125

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name Barclay E.  
Joint Welding Procedure Tig  
Part number and Job number ~~0058672041/83337 A~~  
Also good for A206 Same / cross bolt spacer

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig  
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skid tube

TEST RESULTS


Visual . . . Pass ☒ Fail ☐  
Penetration Pass ☒ Fail ☐  
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/09/05 Qualifier David Sewel

Date: Thursday, 11/10/2007 2:26:44 PM  
 User: Linda Lacelle

## Process Sheet

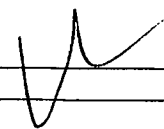Customer : CC-DAR01 Dart Aerospace Ltd.	Drawing Name : D206-642
Job Number : 35132	
Estimate Number : 10804	
P.O. Number :	Part Number : Z_CUSTOM
This Issue : 11/10/2007 S.O. No. :	Drawing Number : ECN 1046-PAPERWORK
Prsht Rev. : NC	Project Number :
First Issue : / / Type : LANDING GEAR	Drawing Revision :
Previous Run : 00015	Material :
Written By : 	Due Date : 18/10/2007 Qty: 1 Um: Each
Checked & Approved By : _____	
Comment :	

## Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1  
 REMOVE FROM STOCK:

D206-642-111 15614 15615  
 D206-642-112 10319 25504  
 D206-642-141 9575 18613  
 D206-642-211 33078 32559-32565-33795-33776  
 D206-642-212 32257 32567-32568-32568-33079-33080-33242  
 D206-642-213 19735  
 D206-642-214 24414-24484-28083-29084-32983-32984  
 D206-642-241 28097-28604-33211-33342  
 D206-642-311 28847  
 D206-642-312 29741-15649-29742-29744  
 D206-642-341 34557-34056-34555-34556-32495-31980  
 D206-642-411 34132  
 D206-642-411BL 34564-34563-34562-34060-34059-32502-34058  
 D206-642-412 34735  
 D206-642-412BL 31066-30940-30260-30265-24739  
 D206-642-441 34522-34579-33848-34581  
 D206-642-511 34586-34584-34583-  
 D206-642-512  
 D206-642-513  
 D206-642-514  
 D206-642-541  
 D206-642-611  
 D206-642-612

ADD NEW PAPERWORK EASA.IM.R.S.01320 REV.1  
 PER ECN 1046

1-11-07 SP